



SCIEX Triple Quad™ 3500 Systems

Site Planning Guide



This document is provided to customers who have purchased SCIEX equipment to use in the operation of such SCIEX equipment. This document is copyright protected and any reproduction of this document or any part of this document is strictly prohibited, except as SCIEX may authorize in writing.

Software that may be described in this document is furnished under a license agreement. It is against the law to copy, modify, or distribute the software on any medium, except as specifically allowed in the license agreement. Furthermore, the license agreement may prohibit the software from being disassembled, reverse engineered, or decompiled for any purpose. Warranties are as stated therein.

Portions of this document may make reference to other manufacturers and/or their products, which may contain parts whose names are registered as trademarks and/or function as trademarks of their respective owners. Any such use is intended only to designate those manufacturers' products as supplied by SCIEX for incorporation into its equipment and does not imply any right and/or license to use or permit others to use such manufacturers' and/or their product names as trademarks.

SCIEX warranties are limited to those express warranties provided at the time of sale or license of its products and are SCIEX's sole and exclusive representations, warranties, and obligations. SCIEX makes no other warranty of any kind whatsoever, expressed or implied, including without limitation, warranties of merchantability or fitness for a particular purpose, whether arising from a statute or otherwise in law or from a course of dealing or usage of trade, all of which are expressly disclaimed, and assumes no responsibility or contingent liability, including indirect or consequential damages, for any use by the purchaser or for any adverse circumstances arising therefrom.

For research use only. Not for use in diagnostic procedures.

AB Sciex is doing business as SCIEX.

The trademarks mentioned herein are the property of AB Sciex Pte. Ltd. or their respective owners.

AB SCIEX™ is being used under license.

© 2017 AB Sciex



AB Sciex Pte. Ltd.
Blk 33, #04-06
Marsiling Ind Estate Road 3
Woodlands Central Indus. Estate.
SINGAPORE 739256

Contents

Chapter 1 Introduction.....	5
Customer Site Planner Responsibilities.....	5
FSE Responsibilities.....	6
During Installation.....	7
Customer Familiarization.....	7
Technical Support.....	8
Chapter 2 Site Planning Checklist.....	9
Customer Information.....	9
Requirements.....	9
Site Layout Requirements.....	9
Electrical Requirements.....	11
Gas Supply Requirements.....	13
Ventilation and Waste-Collection Requirements.....	14
Computer, Network, and Software Requirements	14
Environmental Requirements.....	15
Solutions and Equipment Requirements.....	16
Product Familiarization.....	17
Additional Site Planning.....	17
Comments and Exceptions.....	18
Signoff.....	18
Appendix A Site Requirements.....	19
Site Layout Requirements.....	19
Laboratory Layout and Site Clearances.....	19
Weights and Dimension.....	20
Bench and Floor Loading (Minimum Load Configuration).....	21
Electrical Requirements.....	22
Mains Supply Connections.....	22
Mains Supply Fluctuations.....	25
Protective Earth Conductor.....	25
Uninterruptible Power Supply or Power Conditioner.....	25
System Electrical Specifications.....	26
Gas Supply Requirements.....	28
Optional Gas Generators.....	30
Ventilation and Waste Collection Requirements.....	31
Computer, Network, and Software Requirements.....	33
Acquisition Computer Requirements.....	33
Printer Requirements.....	33
LAN Connection (Optional).....	33

Contents

Software Requirements	34
Environmental Requirements.....	34
Sound Pressure Level.....	35
Vibration.....	35
BioSafety Requirements.....	35
Solutions and Equipment Requirements.....	36
Customer Familiarization.....	36
Mass Spectrometer Operation.....	37
Appendix B Equipment Safety Categories.....	38

This guide is for the site planner, the individual responsible for preparing the facility for the installation of the SCIEX Triple Quad™ 3500 system.

For safety and regulatory information, refer to the *System User Guide*, available at sciex.com.

Customer Site Planner Responsibilities

Complete the [Site Planning Checklist on page 9](#), in consultation with Facilities and Services Personnel (gas, electrical, ventilation, and information technology [IT]), and return it to the SCIEX FSE before the completion date. Refer to [Signoff on page 18](#).

Note: If the site preparation tasks are not complete when the SCIEX Field Service Employee (FSE) arrives, then the scheduled installation will be postponed.

Note: The FSE will follow up if the checklist is not received prior to the scheduled installation date.

- Verify that adequate space and the required shipping or receiving facilities are available. Refer to [Site Layout Requirements on page 19](#).
- Provide all required electrical receptacles. Refer to [Electrical Requirements on page 22](#).
- Provide all required gas supplies, including shut off valves and regulators at the installation point. Refer to [Gas Supply Requirements on page 28](#).
- Provide and install all required vents and ventilation devices. Refer to [Ventilation and Waste Collection Requirements on page 31](#).
- Verify that the requirements for the computer and network are met. Refer to [Computer, Network, and Software Requirements on page 33](#).
- Provide a printer and (optional) active, tested LAN connection. Refer to [Computer, Network, and Software Requirements on page 33](#).
- Verify that the requirements for the operating environment are met. Refer to [Environmental Requirements on page 34](#).
- Provide all required solutions and laboratory equipment, including all fittings, and sample tubing for the liquid chromatography (LC) equipment, unless purchased from SCIEX. Refer to [Solutions and Equipment Requirements on page 36](#).

Introduction

- Validate the customer account.
SCIEX sends an e-mail with the subject, "Please validate your account | Welcome to sciex.com". Open the e-mail and follow the instructions to validate the account and go to [SCIEXUniversity](#). Validation automatically registers the mass spectrometer for support, grants access to productivity tools, and enrolls the customer in the appropriate courses at [SCIEXUniversity](#).

Note: If this e-mail has been lost or deleted, or to add users to the account, contact SCIEXUniversity@sciex.com to request that it be resent. Validation is specific to the order, and must be performed, even if the customer already has an account on [sciex.com](#).

- When the shipment arrives, inspect the packaging exterior for damage. If there is any damage, or if the shock or tip sensors have been tripped, then note any issues on the delivery receipt and notify SCIEX immediately.
- Contact SCIEX Customer Service or the local FSE to schedule the installation.
- Identify a primary learner who will participate in the Customer Familiarization. This individual must complete the prerequisite eLearning module, *Introduction to LC-MS/MS Operation*, available from [SCIEXUniversity](#), and download the course completion certificate.

Note: If the prelearning is not completed, then a demonstration will be substituted for the hands-on portion of the Customer Familiarization. If the customer waives Customer Familiarization, then the FSE only provides training on [SCIEXNow](#) resources.

- If available, identify a qualified maintenance person (QMP) who is suitably aware of the electrical and chemical risks associated with servicing laboratory equipment. The FSE will review the *Qualified Maintenance Person Guide* with this person during the Customer Familiarization process.
- Provide five staff members to assist the FSE in moving the system during installation.

CAUTION: Potential System Damage. Do not unpack the mass spectrometer crate or computer boxes. The FSE will unpack and help move the mass spectrometer at the time of the installation.

FSE Responsibilities

Note: If the site preparation tasks are not complete when the SCIEX Field Service Employee (FSE) arrives, then the scheduled installation will be postponed.

- Review the checklist and discuss outstanding issues with the site planner.
- Supply all fittings, plugs, and cables required to connect the mass spectrometer to the electrical receptacles and gas regulators. Electrical receptacles must be within the maximum distances described in this document.

- Unpack, assemble, and set up any optional SCIEX benches ordered with the mass spectrometer.
- Unpack and set up the mass spectrometer, with the assistance of customer staff.
- Unpack and set up the acquisition computer.
- Unpack and set up optional LC equipment sold and supported by SCIEX. Integrate other supported LC equipment.
- Unpack and set up optional gas generator equipment sold by SCIEX.
- Unpack and set up optional UPS equipment sold by SCIEX.
- Test and qualify the system to the specifications in the *Installation Checklist and Data Log*.

During Installation



WARNING! Lifting Hazard. Make sure that at least six people are available to lift the mass spectrometer. Follow established safe lifting procedures. Refer to [Weights and Dimension on page 20](#) for the weights of system components.

The FSE unpacks the system (with the assistance of customer staff), sets up the system, and then confirms its operation. When the system reaches proper vacuum, the FSE conducts system performance tests.

Note: It takes several days for the FSE to set up the system and confirm operation.

Customer Familiarization

During installation, the FSE familiarizes the primary learner with the SCIEX Triple Quad™ 3500 system and the primary learner practices using the system by following the step-by-step exercise from the *Introduction to LC-MS/MS Operation Series*. This eLearning series is available on [SCIEXUniversity](#) at training.sciex.com. The Customer Familiarization comprises the first phase of the learning experience for the primary learner. To continue learning, the primary learner can log on to [SCIEXUniversity](#).

Note: Customer Familiarization provides hands-on training for the primary learner only. Up to two additional users can be present for the training.

Note: To view personalized training information, including completed courses, assigned courses, and certifications, log on to [SCIEXUniversity](#).

As a prerequisite to the hands-on training, the primary learner must have completed the eLearning module, *Introduction to LC-MS/MS Operation Series*, and must present the course completion certificate to the FSE.

Introduction

Note: If the prelearning is not completed, then a demonstration will be substituted for the hands-on portion of the Customer Familiarization. If the customer waives Customer Familiarization, then the FSE only provides training on [SCIEXNow](#) resources.

The format and extent of the Customer Familiarization depends on the customer configuration, as follows:

- New installation of a SCIEX-sold and supported high-flow HPLC system (ExionLC™, Eksigent Ultra, Agilent, CTC, or Shimadzu system): The entire customer familiarization is completed, providing hands-on familiarization to the primary learner. The results are saved on the acquisition computer.
- Eksigent NanoLC, M3 MicroLC, or M3 MicroLC-TE system: The mass spectrometer customer familiarization is completed, except for the Hands-On Lab Exercise. The FSE completes the *Customer Familiarization Checklist* for the NanoLC, M3 MicroLC, or M3 MicroLC-TE system instead. Refer to the *Customer Familiarization Checklist* for the NanoLC, M3 MicroLC, or M3 MicroLC-TE system.
- HPLC system not installed by SCIEX at the time of mass spectrometer installation: The FSE is not responsible for verifying the functionality of the HPLC system. The following topics are not covered:
 - Plumb the HPLC System and Load the Samples
 - Build the Acquisition Method
 - Create the Acquisition Batch
 - Submit the BatchSample preparation procedures will be completed and a set of example data will be used to perform the data analysis.

Note: Familiarization for equipment supplied by other manufacturers is not provided by the SCIEX FSE.

Technical Support

SCIEX and its representatives maintain a staff of fully-trained service and technical specialists located throughout the world. They can answer questions about the system or any technical issues that might arise. For more information, visit the SCIEX website at sciex.com.

Site Planning Checklist

2

Customer Information

Contact name			
Organization			
Address			
City			
State/Province/Region		ZIP code/Postal code	
Country			
Telephone			
E-mail address			

Requirements

Site Layout Requirements

Refer to [Site Layout Requirements on page 19](#).

Requirement	Complete	N/A
The measured building clearances can accommodate the equipment and crate dimensions. If the requirements cannot be met, then contact a sales or field service representative.		

Site Planning Checklist

Mass Spectrometer Bench Requirements

Refer to [Site Layout Requirements on page 9](#).

Requirement	Complete	N/A
<p>A moveable or fixed bench that meets the physical requirements (dimensions and weight) of the system is provided for the mass spectrometer. Refer to Weights and Dimension on page 20. If the bench is fixed, then there is 1 m (40 inches) of clearance on all sides for service access. If the bench is moveable, then there is 0.3 m (12 inches) of clearance on all sides.</p> <hr/> <p>Note: If the bench is moveable, then</p> <ul style="list-style-type: none">• Make sure that the bench is fixed during normal use.• Make sure that the mass spectrometer can be moved to a location with 1 m of clearance on all sides for service access. <hr/>		

Electrical Requirements

Refer to [Electrical Requirements on page 22](#).

Requirement	Complete	N/A
Installation of electrical supplies and fixtures complies with local regulations and safety standards.		
One branch circuit is provided for the mass spectrometer. The mains supply outlet is less than 1.6 m (63 inches) from the mass spectrometer. One outlet is required. The outlet is accessible so that the mass spectrometer can be disconnected in an emergency.		
One branch circuit is provided for the roughing pump. The mains supply outlet for the roughing pump is less than 1.6 m (63 inches) from the roughing pump. One outlet is required.		
One branch circuit is provided for the acquisition computer, monitor, printer, and options. At least two outlets are required, for the acquisition computer and monitor. For LC equipment and other options, contact the manufacturer for more information.		
(Optional) One branch circuit is provided for a standalone gas generator with an air compressor. Contact the manufacturer of the gas generator for more information.	○	○
The mains supply voltage does not fluctuate more than $\pm 10\%$ from the nominal voltage. Note: Peripheral devices might have different mains supply fluctuation limits. Confirm the mains supply fluctuation limit with the vendor of each peripheral device that will be used with the mass spectrometer.		
The mains supply includes a correctly installed protective earth conductor.		

Site Planning Checklist

Requirement	Complete	N/A
<p>(Optional) A customer-supplied UPS or power conditioner is provided for the system. The UPS or power conditioner must deliver 230 VAC, 50 Hz or 60 Hz, 4000 VA (minimum). Refer to Uninterruptible Power Supply or Power Conditioner on page 25.</p> <hr/> <p>Note: SCIEX sells and supports several UPS power protection units for mass spectrometer systems that are custom configured to provide a total backup power solution. Contact a SCIEX sales representative for more information.</p> <hr/> <p>A qualified electrician has determined the appropriate mains supply configuration based on the system electrical specifications. Refer to System Electrical Specifications on page 26.</p>	○	○

Electrical Requirements (International)

Refer to [Electrical Requirements on page 22](#).

Requirement	Complete	N/A
Electrical installations use locally approved standard connections and cables.	○	○

Electrical Requirements (North America)

Refer to [Electrical Requirements on page 22](#).

Requirement	Complete	N/A
Branch circuits for the mass spectrometer and roughing pump are 15 A, 200 VAC to 240 VAC (208 VAC typical), 50 Hz or 60 Hz. Receptacles for these branch circuits are equipped with CSA/NEMA 6-15R straight-blade receptacles.	○	○
<p>The branch circuit for the computer and monitor is 15 A, 100 VAC to 240 VAC (120 VAC typical), 50 Hz or 60 Hz.</p> <p>For requirements for LC equipment, contact the manufacturer.</p>	○	○

Gas Supply Requirements

Refer to [Gas Supply Requirements on page 28](#).

Requirement	Complete	N/A
Installation of gas supplies and connections complies with local regulations and safety standards.		
Gas 1/Gas 2/bath gas is available: <ul style="list-style-type: none"> • Zero-grade air or a SCIEX-recommended gas generator • Delivery pressure of 100 psi (6.89 bar) minimum to 105 (7.25 bar) psi maximum with flows up to 22 L/min 		
Source exhaust gas is available: <ul style="list-style-type: none"> • Clean, dry, and oil-free air or ultra-high purity (UHP) nitrogen (99.999%) or a SCIEX-recommended gas generator • Delivery pressure of 55 psi (3.79 bar) minimum to 60 psi (4.14 bar) maximum with flows up to 10 L/min 		
Curtain Gas TM supply/bath gas/CAD gas is available: <ul style="list-style-type: none"> • UHP nitrogen or a SCIEX-recommended gas generator • Delivery pressure of 55 psi (3.79 bar) minimum to 60 psi (4.14 bar) maximum with flows up to 10 L/min 		
(Optional) If a SCIEX mass spectrometer bench with a built-in gas generator or if a SCIEX-recommended wall-mounted gas generator without a compressor is used, then a supply of compressed oil-free air is provided. Contact the manufacturer for more information.	○	○

Note: Under normal conditions, bath gas is taken from the same supply as the Gas 1 and Gas 2 gas flows.

Ventilation and Waste-Collection Requirements

Refer to [Ventilation and Waste Collection Requirements](#) on page 31.

Requirement	Complete	N/A
Installation of plumbing and ventilation fixtures complies with local regulations and safety standards.		
Ventilation of the laboratory environment in which the mass spectrometer will be used complies with local regulations and the air exchange rate is appropriate for the work performed. A minimum of 10 air exchanges/hour is required.		
A negative flow vent is provided with a total flow rate capacity of 283 L/min (10 cfm), as measured at the inlet to the laboratory ventilation system.		
A smooth fitting is provided for the roughing pump, with an outside diameter (o.d.) of 3.2 cm (1.25 inches). The vent is within 1.5 m (60 inches) of the exhaust port on the roughing pump and at least 1 m (40 inches) above the floor.		
A fitting is provided for the source exhaust drain bottle with an o.d. of 2.5 cm (1.0 inch). The vent is within 1.5 m (60 inches) of the source exhaust drain bottle.		

Computer, Network, and Software Requirements

Refer to [Computer, Network, and Software Requirements](#).

Requirement	Complete	N/A
A table is provided for the acquisition computer, located within 3 m (120 inches) of the mass spectrometer.		
A computer name and password are available.		
(Optional) A network or IT specialist is available to install the security software while the FSE is present.	○	○
A network printer or a dedicated printer and the necessary print drivers are available.		
(Optional) An active, tested LAN connection is available.	○	○
(Optional) The computer name and password supplied are a network computer name and domain password.	○	○

Requirement	Complete	N/A
(Optional) A network or IT specialist is available to connect the computer to the company LAN while the FSE is present.	<input type="radio"/>	<input type="radio"/>
(Optional) An internet connection and current web browser are available for Customer Familiarization.	<input type="radio"/>	<input type="radio"/>
Note: If the prelearning is not completed, then a demonstration will be substituted for the hands-on portion of the Customer Familiarization. If the customer waives Customer Familiarization, then the FSE only provides training on SCIEXNow resources.		

Software Requirements

Refer to [Software Requirements on page 34](#).

Requirement	Complete	N/A
Any SCIEX software purchased (other than the Analyst [®] software) and intended to be installed by the FSE is available at the time of installation. Software can be downloaded from the SCIEX web site, or a software installation DVDs purchased. Contact the sales representative to purchase software DVDs, if required.	<input type="radio"/>	<input type="radio"/>

Environmental Requirements

Refer to [Environmental Requirements on page 34](#).

Requirement	Complete	N/A
The size of the laboratory is at least 31.7 cubic meters (1120 cubic feet).		
An ambient temperature of 15 °C to 30 °C (59 °F to 86 °F) is maintained. Over time, the temperature remains within a range of 4 °C (7.2 °F), with the rate of the change in temperature not exceeding 2 °C (3.6 °F) per hour. Ambient temperature fluctuations exceeding the limits might result in mass shifts in spectra.		
Note: Peripheral devices might have different operating environment requirements. Confirm the operating environment requirements with the vendor of each peripheral device that will be used with the system.		
Relative humidity is 35% to 50%, non-condensing.		

Site Planning Checklist

Requirement	Complete	N/A
Air conditioning provides a minimum of 6500 Btu/hr (mass spectrometer and roughing pump only).		
(Optional) A customer-supplied soft wall is installed behind the mass spectrometer to reduce noise.	<input type="radio"/>	<input type="radio"/>

BioSafety Requirements

Refer to [BioSafety Requirements on page 35](#).

Requirement	Complete	N/A
The site is not designated as BioSafety Level 3 (BSL-3) or BioSafety Level 4 (BSL-4).		

Solutions and Equipment Requirements

Refer to [Solutions and Equipment Requirements on page 36](#).

Requirement	Complete	N/A
All of the required solutions and bottles are available.		
All of the required LC equipment and supplies are available.		
All materials required for Customer Familiarization are available. Note: If the prelearning is not completed, then a demonstration will be substituted for the hands-on portion of the Customer Familiarization. If the customer waives Customer Familiarization, then the FSE only provides training on SCIEXNow resources.	<input type="radio"/>	<input type="radio"/>

Product Familiarization

Requirement	Complete	N/A
<p>Internet access is available. SCIEX recommends that the acquisition computer be used, but alternatively, another computer or mobile (Android or iOS) device can be used.</p> <p>Note: To use the online learning system on the acquisition computer, upgrade the web browser to the latest available version.</p>		
<p>An account has been created on sciex.com and the account has been validated, following the instructions in the e-mail from SCIEX.</p> <p>Note: Validation automatically registers the mass spectrometer for support, grants access to productivity tools, and enrolls the customer in the appropriate courses at SCIEXUniversity.</p>	○	○
<p>The online learning module, <i>Introduction to LC-MS/MS Operation Series</i>, has been completed. A certificate of completion is available.</p> <p>Note: If the prelearning is not completed, then a demonstration will be substituted for the hands-on portion of the Customer Familiarization. If the customer waives Customer Familiarization, then the FSE only provides training on SCIEXNow resources.</p>	○	○
<p>System documentation has been obtained and reviewed. Go to sciex.com/products.</p>		
<p>(Optional) A qualified maintenance person (QMP) who is suitably aware of the electrical and chemical risks associated with servicing laboratory equipment is available for review of the service procedures with the FSE.</p>	○	○

Additional Site Planning

Requirement	Complete	N/A
<p>Site planning for optional peripheral devices and software is completed, as required.</p>	○	○

Comments and Exceptions

Signoff

Site planner contact name		Completion date (yyyy-mm-dd)	
I acknowledge that all of the installation requirements, as specified in this document, have been met.			
FSE name		Return date (yyyy-mm-dd)	
FSE e-mail			


Site Layout Requirements

[Return to checklist.](#)

Laboratory Layout and Site Clearances

Make sure that the site meets the required building clearances for installation and service access. Refer to [Figure A-1](#).

Figure A-1 Laboratory Layout

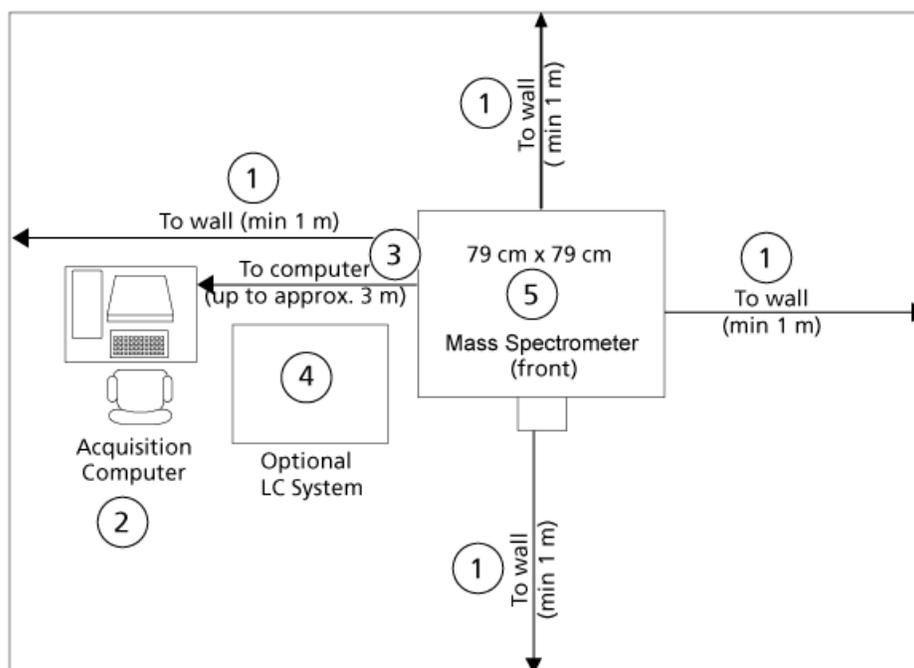

Site Requirements

Item	Description
1	Distance to wall. For fixed bench configurations, a minimum of 1 m (40 inches) is required. For moveable bench configurations, a minimum of 0.3 m (12 inches) is required.  WARNING! Electrical Shock Hazard. Make sure that the system can be disconnected from the mains supply outlet in an emergency. Do not block the mains supply outlet.
2	Acquisition computer
3	Distance to computer, up to approx 3 m (120 inches)
4	Optional LC components
5	Mass spectrometer (front), 79 cm × 79 cm (32 inches × 32 inches)

Note: If the bench is moveable, then

- Make sure that the bench is fixed during normal use.
- Make sure that the mass spectrometer can be moved to a location with 1 m of clearance on all sides for service access.

Weights and Dimension

Refer to the following tables for weights and dimensions and make sure that the system can be moved to the installation site. Make sure that the installation site can accommodate the equipment dimensions, weight, and associated clearance.

The mass spectrometer has been designed to support 77.5 kg (170 lbs). The optional SCIEX bench is designed to support the weight of the mass spectrometer plus its associated load, roughing pumps, and an additional 77.5 kg (170 lbs).

Table A-1 Mass Spectrometer and Bench

Equipment	Height	Width	Length	Weight
Crate	85 cm (34 inches)	112 cm (44 inches)	100 cm (39 inches)	88 kg (194 lbs)
Mass spectrometer	59 cm (24 inches)	79 cm (32 inches)	79 cm (32 inches)	130 kg (285 lbs)
Roughing pump	22 cm (9 inches)	30 cm (12 inches)	42 cm (17 inches)	34 kg (75 lbs)
Mass spectrometer bench (optional)	78 cm (31 inches)	100 cm (40 inches)	84 cm (34 inches)	120 kg (265 lbs)
Accessories crate	129.5 cm (51 inches)	104 cm (41 inches)	132 cm (52 inches)	178 kg (391 lbs)

Table A-2 Acquisition Computer

Equipment	Height	Width	Length	Weight
Dell OptiPlex XE2	36.0 cm (14.2 inches)	17.5 cm (6.9 inches)	41.7 cm (16.4 inches)	9.4 kg (20.68 lbs)
Monitor	35.42 cm (13.9 inches)	51.2 cm (20.1 inches)	18.0 cm (7.0 inches)	5.58 kg (12.28 lbs)
Shipping weight	The acquisition computer and monitor are included in the Accessories box.			

Bench and Floor Loading (Minimum Load Configuration)

Equipment	Load (kg/m ²)	Total Load (kg)	Point Load (kg) per Wheel Based on Four Wheels
Mass spectrometer	208.3	130	32.5
Mass spectrometer, mass spectrometer bench, and roughing pump	336.9	283	70.75
AB-3G gas generator. For other models, consult the specifications supplied by the manufacturer.	214	145	36.25

Electrical Requirements

[Return to checklist.](#)



WARNING! Electrical Shock Hazard. Use only qualified personnel for the installation of all of the electrical supplies and fixtures, and make sure that all of the installations adhere to local regulations and safety standards.

The total combined system (mass spectrometer and roughing pump) power consumption is 2200 VA (50 Hz or 60 Hz) at 230 VAC. An external line transformer is not required for the mass spectrometer, optional mass spectrometer bench, or roughing pump.

If the voltage changes more than 10% in 24 hours, then use a power conditioner. High or low voltages can adversely affect the electronic components of the equipment.

Mains Supply Connections



WARNING! Electrical Shock Hazard. Make sure that the system can be disconnected from the mains supply outlet in an emergency. Do not block the mains supply outlet.


Provide a minimum of three branch circuits. Refer to [Figure A-2](#).

- One branch circuit for the mass spectrometer.
- One branch circuit for the roughing pump.
- One branch circuit for the acquisition computer, monitor, and printer. This branch circuit can also be used for options such as:
 - Mass spectrometer bench
- (Optional) One branch circuit for a standalone gas generator with a compressor. Contact the manufacturer of the gas generator for more information. The optional mass spectrometer bench can also be connected to this branch circuit.

For electrical requirements for SCIEX-supplied components, refer to [System Electrical Specifications on page 26](#). For requirements for other components, such as the optional LC system, contact the manufacturer.

Note: Use receptacles that comply with local standards. Receptacles shown in [Figure A-2](#) are representations only.

Figure A-2 Branch Circuit Configuration

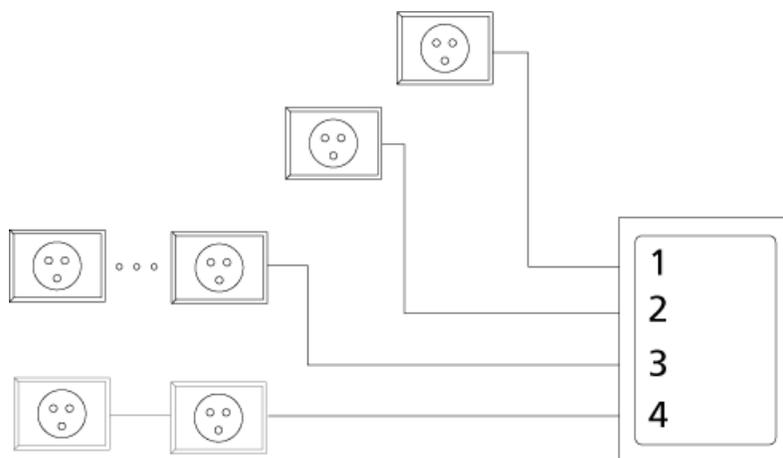

Item	Description
1	Branch circuit for the mass spectrometer. One outlet is required. It must be within 1.6 m (63 inches) of the mass spectrometer.
2	Branch circuit for the roughing pump. One outlet is required. Outlets must be within 1.6 m (63 inches) of the roughing pump.
3	Additional branch circuit for the acquisition computer, monitor, and printer, as well as any options. The optional mass spectrometer bench can be connected to this branch circuit.
4	(Optional) One branch circuit with one or more outlets for a standalone gas generator with a compressor. Contact the manufacturer of the gas generator for more information. The optional mass spectrometer bench can be connected to this branch circuit.

Site Requirements

International Requirements

- For installations outside of North America, use locally approved standard connections and cables.


Table A-3 Socket Types

Region	Mains Power Socket Type
Central Europe	CEE 7/7
Italy	CEI 23-50 or CEE 7/7
India	IS1293
Switzerland	SEV1011
United Kingdom/Ireland	BS13
Australia/New Zealand	AS/NZS 3112
China	GB-2009
Japan	L6/20P
South Korea	KSC8305
North America	CSA/NEMA 6-15

Note: Refer to the *Parts and Equipment Guide* for recommended AC mains power cables.

North American Requirements

- Branch circuits for the mass spectrometer and roughing pump (branch circuits 1 and 2 in [Figure A-2 on page 23](#)) must be 15 A, 200 VAC to 240 VAC (typical 208 VAC), 50 Hz or 60 Hz. Receptacles are equipped with CSA/NEMA 6-15R straight blade receptacles. Refer to [Figure A-3](#) .
- The branch circuit for the acquisition computer and monitor (branch circuit 4 in [Figure A-2 on page 23](#)) can be 15 A 120 VAC.
- (Optional) Branch circuits and receptacles for the gas generator must meet the requirements in the documentation supplied by the manufacturer.

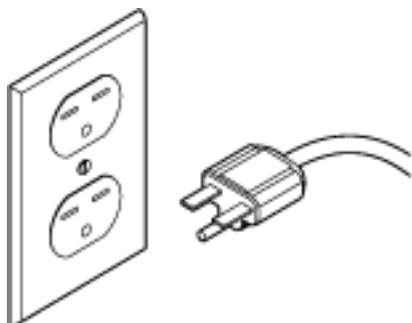Figure A-3 Duplex Receptacle and Plug

Mains Supply Fluctuations

In areas where the mains supply is subject to voltage fluctuations exceeding $\pm 10\%$ of the nominal value (200 VAC to 240 VAC), a power conditioner is required. High or low voltages can adversely affect the electronic components of the system. Refer to [Uninterruptible Power Supply or Power Conditioner on page 25](#).

Note: Peripheral devices might have different mains supply fluctuation limits. Confirm the mains supply fluctuation limit with the vendor of each peripheral device that will be used with the mass spectrometer.

Protective Earth Conductor



WARNING! Electrical Shock Hazard. Do not intentionally interrupt the protective earth conductor. Any interruption of the protective earth conductor creates an electrical shock hazard.

The mains supply must include a correctly installed protective earth conductor that must be installed or inspected by a qualified electrician before the system is connected.

Uninterruptible Power Supply or Power Conditioner

Use a pure sine-wave uninterruptible power supply (UPS) or power conditioner to allow a safe shutdown of the system (mass spectrometer, computer, monitor, and roughing pump) during power outages.

Note: The FSE will install optional UPS equipment purchased from SCIEX. The customer is responsible for installing any customer-supplied UPS equipment.

Site Requirements

Table A-4 UPS and Power Conditioner Requirements

Specification	Requirement
Output voltage	200 VAC to 240 VAC True on line (double conversion)
Frequency	50 Hz or 60 Hz
Waveform	Pure sine-wave
Minimum peak current	3 × nominal current
Output voltage distortion	< 3%
Output protection	Circuit breaker
Minimum power requirement	4000 VA

System Electrical Specifications

These tables contain the electrical specifications for the mass spectrometer, roughing pump, computer, and monitor.

Note: Specifications are subject to change without notice.

Table A-5 Mass Spectrometer Electrical Specifications

Specification	Value
Nominal input voltage	200 VAC to 240 VAC
Frequency	50 Hz or 60 Hz
Maximum input current	10 A
Maximum input power	1000 VA

Table A-6 Roughing Pump Electrical Specifications

Specification	Value
Nominal input voltage	200 VAC to 240 VAC
Frequency	50 Hz or 60 Hz
Maximum input current	4.2 A
Maximum input power	1420 VA

Table A-7 Computer Electrical Specifications

Specification	Value
Computer	
Nominal input voltage	100 VAC to 240 VAC
Frequency	50 Hz or 60 Hz
Maximum input current	5 A
Monitor	
Nominal input voltage	100 VAC to 240 VAC
Frequency	50 Hz or 60 Hz
Maximum input current	2.5 A

Table A-8 System Bench Electrical Specifications

Specification	Value
Nominal input voltage	200 VAC to 240 VAC
Frequency	50 Hz or 60 Hz
Maximum input current	1A
Maximum input power	240 VA

Gas Supply Requirements

[Return to checklist.](#)




WARNING! Toxic Chemical Hazard. Use only qualified personnel for the installation of all gas supplies and connections, and make sure that all installations adhere to local regulations and safety standards. Carrier gas nitrogen can be an asphyxiant if released into environments with insufficient ventilation.

CAUTION: Potential System Damage. Regulate each supply separately at the mass spectrometer to prevent over pressure damage to the mass spectrometer.

CAUTION: Potential System Contamination. Use compression fittings for gas line connections. Do not use liquid pipe sealant. If threaded fittings must be used, then Teflon tape can be used to seal the threads. Do not use soldered fittings unless the tubing is thoroughly cleaned afterwards.

Figure A-4 Recommended Gas Connections

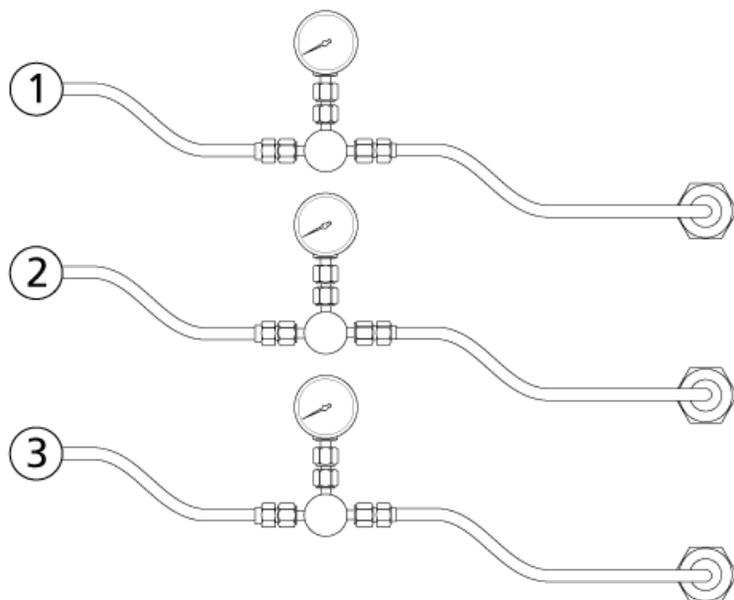

Item	Gas	Description	Pressure	Flow Rate (max)	Tubing
1	Curtain Gas™ supply /bath gas/ CAD gas	Ultra high purity (UHP) N ₂ (99.999%) only	55 psi (3.79 bar) minimum to 60 psi (4.14 bar) maximum	10 L/min	1/4 inch (0.64 cm)
2	Gas 1/Gas 2/bath gas	Zero grade air or UHP N ₂	100 psi (6.89 bar) minimum to 105 psi (7.25 bar) maximum	22 L/min	1/4 inch (0.64 cm)
3	Source exhaust	Clean, dry, oil-free air or UHP N ₂	55 psi (3.79 bar) minimum to 60 psi (4.14 bar) maximum	10 L/min	1/4 inch (0.64 cm)


Note: Gas quality, flows, and pressures must meet the requirements in [Figure A-4](#), or a SCIEX-approved gas generator must be used.

Note: Under normal conditions, bath gas is taken from the same supply as the Gas 1 and Gas 2 gas flows.

Note: Under some conditions, using air instead of nitrogen for Gas 1/Gas 2 might improve sensitivity and signal-to-noise.

Note: The air input fitting on the back panel is a quick connect, shown in [Figure A-5](#). The nitrogen input fitting is a 1/4-inch Swagelok connection, shown in [Figure A-6](#). All connections to the laboratory supply are Swagelok connections, shown in [Figure A-6](#).

Figure A-5 Quick-connect Fitting

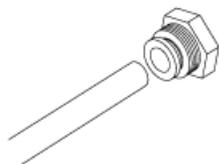

Site Requirements

Figure A-6 Swagelok Connection and Tubing



Optional Gas Generators

Gas generators are available from SCIEX. Contact a sales representative for more information.

Refer to the documentation supplied by the manufacturer for specifications and for the number and type of outlets required.

Ventilation and Waste Collection Requirements

[Return to checklist.](#)



WARNING! Radiation Hazard, Biohazard, or Toxic Chemical Hazard. Make sure that the source exhaust system is connected and functioning and that good general laboratory ventilation is provided. Adequate laboratory ventilation is required to control solvent and sample emissions and to provide for safe operation of the mass spectrometer.




WARNING! Radiation Hazard, Biohazard, or Toxic Chemical Hazard. Use only qualified personnel for the installation of plumbing and ventilation fixtures, and make sure that all installations follow local bylaws and regulations.

CAUTION: Potential System Damage. Do not connect the source exhaust hose to the vent. The connection must be made by a qualified FSE.

- Provide a ventilation system with a total negative flow rate capacity of 283 L/min (10 cfm) at item 1 in [Figure A-7](#) and a minimum of 10 air exchanges per hour.
- Provide a smooth fitting for the roughing pump, with an outside diameter (o.d.) of 3.2 cm (1.25 inches). The vent must be within 1.5 m (60 inches) of the exhaust port on the roughing pump, and at least 1 m (40 inches) above the floor. Refer to [Figure A-7](#).
- Provide a fitting for the source exhaust drain bottle with an o.d. of 2.5 cm (1.0 inch). The vent must be within 1.5 m (60 inches) of the source exhaust drain bottle. Refer to [Figure A-7](#).

Figure A-7 Vent Connections

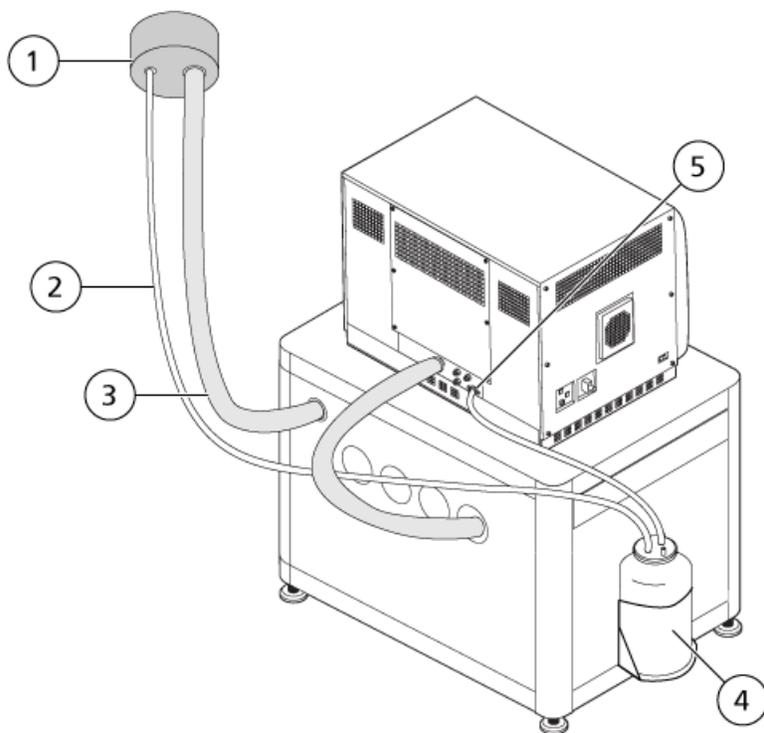

Item	Description
1	Vent
2	Source exhaust hose: 2.5 cm (1 inch) inside diameter (i.d.)
3	Roughing pump exhaust hose: 3.2 cm (1.25 inches) i.d.
4	Source exhaust drain bottle. Make sure that the bottle is secured at all times to prevent spills.
5	Source exhaust drain tubing: 1.6 cm (0.625 inch) i.d.

Note: Source exhaust hose connections at the drain bottle, mass spectrometer, and the lab vent are secured with hose clamps.

Computer, Network, and Software Requirements

[Return to checklist.](#)

Acquisition Computer Requirements

The acquisition computer and monitor are provided with the mass spectrometer. The acquisition computer controls the mass spectrometer. It should be used exclusively for data acquisition.

- Provide a table for the acquisition computer and monitor, within 3 m (120 inches) of the mass spectrometer.
- Provide a computer name and password that comply with these guidelines:
 - The computer name does not have any spaces.
 - The password for the computer is not blank.

Note: If the acquisition computer will be connected to the LAN, then this must be a network computer name and password. Refer to [LAN Connection \(Optional\) on page 33](#).

CAUTION: Potential System Damage. Other than security software, do not install additional software on the acquisition computer. Changes to the configured software could void the system warranty and cause the system to stop operating.

- If security software is required, then make sure that an IT specialist is available to install the security software (anti-virus, anti-malware, or backup software) while the FSE is present.

For the latest guidance on cybersecurity for SCIEX products, visit sciex.com/Documents/brochures/win7-SecurityGuidance.pdf.

Printer Requirements

The system can be connected to a network or dedicated printer.

Note: To use a network printer, connect the acquisition computer to the company network.

- Make sure that a printer and its associated print drivers are available before the scheduled installation.

LAN Connection (Optional)

To connect the acquisition computer to the network:

- Make sure that an active, tested LAN connection is in place before the scheduled installation date.

Site Requirements

- Provide network credentials for the acquisition computer that comply with the guidelines provided for the computer name and password, as specified previously.

Note: Do not change the network computer name after the software has been installed.

- Make sure that an IT specialist is available to connect the computers to the LAN while the FSE is present.

Software Requirements

[Return to checklist.](#)

SCIEX software purchased and intended to be installed by the FSE must be available at the time of installation. Software can be obtained in one of the following ways:

- Download the software from sciex.com/software-downloads-x2110.

Note: Internet access is required to download the software. We recommend that all of the software be downloaded in advance of the scheduled installation to expedite the installation.

- Purchase the software installation DVD. For more information, contact the SCIEX sales representative. The DVD must be purchased in advance and it must be available during the hardware installation.

Environmental Requirements

[Return to checklist.](#)



DANGER! Explosion Hazard. Do not operate the system in an environment containing explosive gases. The system is not designed for operation in an explosive environment.

- Minimum room size of 31.7 cubic meters (1120 cubic feet)
- An ambient temperature of 15 °C to 30 °C (59 °F to 86 °F)
Over time, the temperature must remain within a range of 4 °C (7.2 °F), with the rate of the change in temperature not exceeding 2°C (3.6°F) per hour. Ambient temperature fluctuations exceeding the limits might result in mass shifts in spectra.
- Relative humidity from 35% to 50%, non-condensing
- Cooling and venting for the mass spectrometer and roughing pump: 6500 Btu/hr

CAUTION: Potential System Damage. Do not install the roughing pump in an enclosed unventilated area. Installing the roughing pump in an unventilated area will cause it to shut down due to overheating and can cause severe damage to the mass spectrometer.

Note: Operation of the mass spectrometer at altitudes higher than 2000 m (6400 feet) above sea level might impact mass spectrometer operation.

Note: Peripheral devices might have different operating environment requirements. Confirm the operating environment requirements with the vendor of each peripheral device that will be used with the system.

Sound Pressure Level

Sound Pressure	Value
Average sound pressure level at 1 m (40 inches) from the mass spectrometer	66 dBA

A sound pressure level of 85 dBA above a reference sound pressure of 20 μ Pa is at present regarded by many authorities as the threshold at which a hazard might be caused. Special means, such as the use of protective ear pieces, can make a higher sound pressure level non-hazardous to the operator.

SCIEX recommends that the sound pressure level be measured or calculated by the user both at the position of the operator in normal use and at whatever point 1 m from the enclosure of the equipment has the highest sound pressure level. Refer to [Laboratory Layout and Site Clearances on page 19](#) to minimize sound pressure levels to the operator. Other methods such as the introduction of acoustic barriers or the fitting of noise-reducing baffles or hoods might be used to minimize sound pressure levels.

Vibration

- The packaged mass spectrometer was tested to confirm that the effects of transportation do not affect mass spectrometer performance upon arrival at the customer destination.
- The mass spectrometer is designed to operate in any laboratory environment that accommodates precision analytical instrumentation.

BioSafety Requirements

The site must not be designated BioSafety Level 3 (BSL-3) or BioSafety Level 4 (BSL-4). SCIEX does not install, service, or repair SCIEX systems in areas designated BSL-3 or BSL-4.

Solutions and Equipment Requirements

[Return to checklist.](#)



WARNING! Toxic Chemical Hazard. Refer to the chemical product *Safety Data Sheets* and follow all of the recommended safety procedures when handling, storing, and disposing of chemicals. For health and safety precautions, refer to the *System User Guide*.

Customer Familiarization

Customer-Supplied Materials

Description	Size	Quantity
Glass bottle (rinsed thoroughly to standards of use with mass spectrometry)	100 mL	1
Glass bottle (rinsed thoroughly to standards of use with mass spectrometry)	1 L	2
Beaker	250 mL	2
Pre-prepared MS-grade methanol with 0.1% formic acid Note: If pre-prepared solvent is not available, then use the procedure in the <i>Customer Familiarization Checklist</i> to prepare the solvent.	2.5 L	1
Pre-prepared MS-grade water with 0.1% formic acid Note: If pre-prepared solvent is not available, then use the procedure in the <i>Customer Familiarization Checklist</i> to prepare the solvent.	2.5 L	1

Customer-Supplied Lab Equipment

Description	Size	Quantity
Adjustable micropipettes	100 μ L and 1 mL recommended	2
Boxes of pipette tips	100 μ L and 1 mL recommended	2

Description	Size	Quantity
Measuring cylinder	100 mL	2
Vortex mixer (optional)	N/A	1
Glass transfer pipette	N/A	1
PEEK tubing cutter	N/A	1

Mass Spectrometer Operation

In addition to the materials specified in [Customer Familiarization on page 36](#), the following are required:

- Appropriate personal protective equipment, including powder-free gloves (nitrile or neoprene are recommended) and safety glasses
- MS-grade ammonium acetate (100 mg), stored in a desiccator
- MS-grade acetonitrile (2 L), stored in glass bottles
- MS-grade isopropanol (2 L), stored in glass bottles
- Pipettors (20 µL, 100 µL or 200 µL, 1 mL) and tips
- LC system, including waste bottles and required tubing and cutter, unless ordered through SCIEX. For requirements and specifications for the LC system, contact the manufacturer.
- Mass spectrometer bench, unless ordered through SCIEX. Refer to [Weights and Dimension on page 20](#).
- Table for the computer and monitor
- Printer
- Refrigeration for the LC/MS Standards Kit with High/Low concentration PPGs provided by SCIEX
- (Recommended) A secondary containment tray to be installed under the roughing pumps, to capture potential chemical spills

Equipment Safety Categories

B

Description	Category
Equipment pollution degree	Pollution Degree 2
Mains supply transient overvoltage	Overvoltage Category II

Note: Environments with a Pollution Degree 2 rating include laboratories and sales and commercial areas.

For more information, refer to the International Electrotechnical Commission standards IEC 61010-1 and IEC 60364.